


COTI Quick Reference Card (QRC)

Controls



- **Off/On/Brightness**
 - Detent between on/off
 - Rotate clockwise to turn on and increase brightness
- **Mode Select** (press to cycle – either side)
 - Full Therm (High Thermal Sensitivity)
 - Patrol (Reduced Thermal Sensitivity)
 - Outline (Outlines Hot or Cold objects)
 - ** Image Capture (if enabled) **
- **Polarity** (Press Off/On/Brightness button to toggle)
 - Black Hot
 - White Hot
- **Compass** (if enabled in user menu)
 - Press Off/On/Brightness button
 - Hold for 1 second.
- **Calibration** (Single-Point image correction)
 - Press Off/On/Brightness button
 - Hold for 3 seconds.

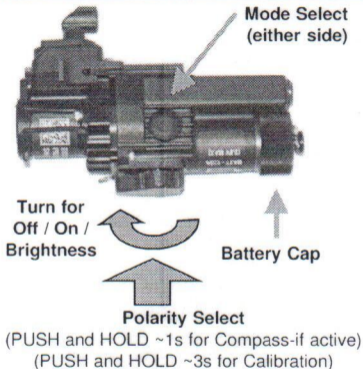

CAGE 1YWM6 #12712-5004 REV:C

COTI Quick Reference Card (QRC)

User Gain Menu (2 sec)

- EXIT (SURE?)
- ENVIRON (NORMAL, RAIN, DESERT, ARCTIC, JUNGLE, URBAN)
- AGC: (**AUTO**, MAN, RESET)
- GAIN (-16, ..., -2, **0**, +2, ..., +16)
- OFFSET (-16, ..., -2, **0**, +2, ..., +16)
- MAXGAIN (1, 2, ..., **31**, ..., 62, 63)

User Imaging Menu (6 sec)

(Only available in Software code 340B or later)

- EXIT (SURE?)
- CAPTURE: (**OFF**, ON)
- REVIEW (SURE?)
- DELETE (DEL ALL?)



CAGE 1YWM6 #12712-5004 REV:C

User Configuration Menu (4 sec)

To enter menus: press "Mode Select" and HOLD for 2, 4, or 6 seconds:

- Polarity Select to advance to next item
- Mode Select to select/change item
- EXIT (SURE?)
- RESET (SURE?)
- ALIGN ↓ (-10, ..., -1, **0**, +1, ..., +10)
- ALIGN ↔ (-10, ..., -1, **0**, +1, ..., +10)
- COMPASS(N/A, OFF, **DEG-MOM**,
DEG-CON, MIL-MOM,
MIL-CON, CAL)
- MAGVAR(+000.0)
- PULSING (**OFF**, BOTH, OUTLINE)
- DEPTH (10%, 20%, **30%**, ..., 100%)
- RATE (1s, 2s, **4s**, 6s, 8s)
- ABC (OFF, LOW, **MED**, HIGH)
- ROT 90° (SURE?)

NOTE: Letters in **BOLD Italics** are factory defaults